

Current Firmware Revision: 1.14

The following notes provide the revision history and a list of known firmware issues in the current release. For more information please call your Extron Application Engineer.

Updated: April 25, 2014
Extron Products Affected: DVS 510 - all models

TECH NOTES

Firmware upload – During the firmware upload, the unit will not respond to front panel or remote control changes. The upload process will take 2 minutes. During this upload time, the LCD will state “Restarting. Please Wait” and the unit will be unresponsive. Do not remove power during the firmware upload process.

Firmware upgrade instructions – Please refer to the user manual for detailed instructions on updating the firmware on the DVS 510. The manual is available on the DVS 510 product page at www.extron.com.



Extron USA - West
Headquarters
+800.633.9876
Inside USA / Canada Only
+1.714.491.1500
+1.714.491.1517 FAX

Extron USA - East
+800.633.9876
Inside USA / Canada Only
+1.919.863.1794
+1.919.863.1797 FAX

 
Extron Europe
+800.3987.6673
Inside Europe Only
+31.33.453.4040
+31.33.453.4050 FAX

Extron Middle East
+971.4.2991800
+971.4.2991880 FAX

Extron Asia
+800.7339.8766
Inside Asia Only
+65.6383.4400
+65.6383.4664 FAX

Extron Japan
+81.3.3511.7655
+81.3.3511.7656 FAX

Extron China
+400.883.1568
Inside China Only
+86.21.3760.1568
+86.21.3760.1566 FAX



KNOWN ISSUES

The following is a list of known firmware issues found in Firmware Version **1.14**.

Restoring a configuration requires a power cycle – In order for the settings contained in the configuration to be restored, a power cycle must be performed after the software tool completes its upload process.



Extron USA - West
Headquarters
+800.633.9876
Inside USA / Canada Only
+1.714.491.1500
+1.714.491.1517 FAX

Extron USA - East
+800.633.9876
Inside USA / Canada Only
+1.919.863.1794
+1.919.863.1797 FAX

 
Extron Europe
+800.3987.6673
Inside Europe Only
+31.33.453.4040
+31.33.453.4050 FAX

Extron Middle East
+971.4.2991800
+971.4.2991880 FAX

Extron Asia
+800.7339.8766
Inside Asia Only
+65.6383.4400
+65.6383.4664 FAX

Extron Japan
+81.3.3511.7655
+81.3.3511.7656 FAX

Extron China
+400.883.1568
Inside China Only
+86.21.3760.1568
+86.21.3760.1566 FAX



FIRMWARE RELEASE HISTORY

Released Version: 1.14**Affects:****Firmware Revision:** 1.13 or earlier**Date(s):** Units shipped prior to April 25, 2014

The following is a list of changes and fixes in this release.

- Fixed issue where the DVS 510 would incorrectly display an HDCP Green Screen on the analog output when a non-encrypted digital input was selected via SIS** – The HDCP detection logic, when switching to digital inputs via SIS, has been updated to properly display non-encrypted inputs on the VGA outputs, and only output the HDCP Green Screen for encrypted inputs.



Extron USA - West
Headquarters
+800.633.9876
Inside USA / Canada Only
+1.714.491.1500
+1.714.491.1517 FAX

Extron USA - East
+800.633.9876
Inside USA / Canada Only
+1.919.863.1794
+1.919.863.1797 FAX

 
Extron Europe
+800.3987.6673
Inside Europe Only
+31.33.453.4040
+31.33.453.4050 FAX

Extron Middle East
+971.4.2991800
+971.4.2991880 FAX

Extron Asia
+800.7339.8766
Inside Asia Only
+65.6383.4400
+65.6383.4664 FAX

Extron Japan
+81.3.3511.7655
+81.3.3511.7656 FAX

Extron China
+400.883.1568
Inside China Only
+86.21.3760.1568
+86.21.3760.1566 FAX



FIRMWARE RELEASE HISTORY

Released Version: 1.13

Affects:

Firmware Revision: 1.07 or earlier

Date(s): Units shipped prior to January 24, 2014

The following is a list of changes and fixes in this release.

- **Fixed intermittent issue where the DVS 510 would permanently display black on the output if left on an inactive DVI input for an extended duration.** – The issue of the DVS 510 permanently outputting black video has been resolved in DVS 510 firmware v1.13.
- **Fixed issue where DVI / HDMI sources may stop outputting video due to a failed EDID read from the DVS 510.** – A firmware logic issue has been resolved, which incorrectly made EDID unavailable during specific portions of the HDCP negotiation process.
- **Fixed issue where DVI PC inputs could be incorrectly detected when the PC was initially booted, resulting in invalid H/V Active values.** – The firmware logic has been updated to automatically match the input sampling values to the detected values from the HDMI / DVI input signal.
- **Fixed issue where the DVS 510 was unable to properly size and center a portrait Apple iPad source when an Auto-Image was applied.** – Improved Auto-Image logic to better handle non-standard video sources, such as an Apple iPad in portrait orientation.
- **Fixed issue where certain Apple computer sources could enter a sluggish state when connected to the DVS 510 and the downstream display device was powered down.** – The firmware logic has been updated to prevent Apple computers from entering a sluggish state which was caused by excessive HDCP negotiation requests, when the downstream display device has been powered down.
- **Multiple updates to HDCP negotiation logic for better compatibility with various 3rd party sink/display devices.**



Extron USA - West
Headquarters
+800.633.9876
Inside USA / Canada Only
+1.714.491.1500
+1.714.491.1517 FAX

Extron USA - East
+800.633.9876
Inside USA / Canada Only
+1.919.863.1794
+1.919.863.1797 FAX

 
Extron Europe
+800.3987.6673
Inside Europe Only
+31.33.453.4040
+31.33.453.4050 FAX

Extron Middle East
+971.4.2991800
+971.4.2991880 FAX

Extron Asia
+800.7339.8766
Inside Asia Only
+65.6383.4400
+65.6383.4664 FAX

Extron Japan
+81.3.3511.7655
+81.3.3511.7656 FAX

Extron China
+400.883.1568
Inside China Only
+86.21.3760.1568
+86.21.3760.1566 FAX



FIRMWARE RELEASE HISTORY

Released Version: 1.07

Affects:

Firmware Revision: 1.02 or earlier

Date(s): Units shipped prior to May 2, 2012

The following is a list of changes and fixes in this release.

- **Fixed intermittent issue where the ZOOM settings were incorrectly applied at startup or after an input switch** – The issue of incorrect ZOOM setting being applied has been resolved in DVS 510 firmware v1.07.
- **Fixed issue where the Input and User presets were not being saved in the Box/IP configuration**– The Save and Restore configuration functions have been updated in firmware v1.07 to correctly restore Input and User Presets.
- **Fixed issue where the unsolicited SIS responses of input switches were sent before the actual video switch** – The firmware logic has been updated to prevent the input switching SIS response from being sent out until the video switch has occurred.
- **Fixed issue where the DVS 510 was unable to detect the video out of a Hewlett Packard 6730B laptop going through a DAV 101CM** – The firmware has been updated to add a sync filter to eliminate issues caused by ringing.
- **Fixed intermittent issue where switching between input 8 and 10 could lead to a muted DVI output** – The encryption logic has been updated to improve switching between encrypted and non-encrypted digital sources.
- **HDMI Data setting has been removed.**



Extron USA - West
Headquarters
+800.633.9876
Inside USA / Canada Only
+1.714.491.1500
+1.714.491.1517 FAX

Extron USA - East
+800.633.9876
Inside USA / Canada Only
+1.919.863.1794
+1.919.863.1797 FAX

Extron Europe
+800.3987.6673
Inside Europe Only
+31.33.453.4040
+31.33.453.4050 FAX

Extron Middle East
+971.4.2991800
+971.4.2991880 FAX

Extron Asia
+800.7339.8766
Inside Asia Only
+65.6383.4400
+65.6383.4664 FAX

Extron Japan
+81.3.3511.7655
+81.3.3511.7656 FAX

Extron China
+400.883.1568
Inside China Only
+86.21.3760.1568
+86.21.3760.1566 FAX